

2014 WATER QUALITY REPORT SAN ANTONIO WATER SYSTEM

This report is a summary of the quality of water San Antonio Water System (SAWS) provides its customers. The analysis was made by using the data from the most recent U.S. Environmental Protection Agency (EPA) required tests and is presented in this report. We hope this information helps you become knowledgeable about what is in your drinking water.

SOURCE OF DRINKING WATER

The sources of drinking water (both tap water and bottled water) include rivers, lakes, streams, ponds, reservoirs, springs, and wells. As water travels over the surface of the land or through the ground, it dissolves naturally-occurring minerals and, in some cases, radioactive material, and can pick up substances resulting from the presence of animals or from human activity.

Contaminants that may be present in source water include:

- Microbial contaminants, such as viruses and bacteria, which
 may come from sewage treatment plants, septic systems,
 agricultural livestock operations, and wildlife
- Inorganic contaminants, such as salts and metals, which can be naturally-occurring or result from urban storm water runoff, industrial or domestic wastewater discharges, oil and gas production, mining, or farming
- Pesticides and herbicides, which may come from a variety of sources such as agriculture, urban storm water runoff, and residential uses
- Organic chemical contaminants, including synthetic and volatile organic chemicals, which are by-products of industrial processes and petroleum production, and can also come from gas stations, urban storm water runoff, and septic systems.
- Radioactive contaminants, which can be naturallyoccurring or be the result of oil and gas production and mining activities

WHERE DO WE GET OUR DRINKING WATER?

The source of SAWS drinking water originated as groundwater from the Edwards, Carrizo, and Trinity aquifers, and in some areas, surface water from Canyon Lake, Lake Dunlap and Medina Lake. A Source Water Susceptibility Assessment for your drinking water source(s) is currently being updated by the Texas Commission on Environmental Quality. This information describes the susceptibility and types of constituents that may come into contact with your drinking water source based on human activities and natural conditions.

The information contained in the assessment allows us to focus source water protection strategies. Some of this source water assessment information is available on Texas Drinking Water Watch at http://dww.tceq.state.tx.us/DWW/.

For more information on source water assessments and protection efforts at our systems, please contact us.

ALL DRINKING WATER MAY CONTAIN CONTAMINANTS

When drinking water meets federal standards, there may not be any health benefits to purchasing bottled water or point of use devices. Drinking water, including bottled water, may reasonably be expected to contain at least small amounts of some contaminants. The presence of contaminants does not necessarily indicate that water poses a health risk. More information about contaminants and potential health effects can be obtained by calling the EPA's Safe Drinking Water Hotline (800-426-4791).

SECONDARY CONSTITUENTS

Many constituents (such as calcium, sodium, or iron), which are found in drinking water, can cause taste, color, and odor problems. The taste and odor constituents are called secondary constituents and are regulated by the State of Texas, not the EPA. These constituents are not causes for health concern. Therefore, secondaries are not required to be reported in this document, but they may affect the appearance and taste of your water.


HEALTH INFORMATION ABOUT LEAD

If present, elevated levels of lead can cause serious health problems, especially for pregnant women and young children.

Lead in drinking water is primarily from materials and components associated with service lines and home plumbing. This water supply is responsible for providing high quality drinking water but cannot control the variety of materials used in plumbing components. When your water has been sitting for several hours, you can minimize the potential for lead exposure by flushing your tap for 30 seconds to two minutes before using water for drinking or cooking. If you are concerned about lead in your water, you may wish to have your water tested. Information on lead in drinking water, testing methods, and steps you can take to minimize exposure is available from the Safe Drinking Water Hotline or at http://www.epa.gov/safewater/lead.

SPECIAL NOTICE

You may be more vulnerable than the general population to certain microbial contaminants, such as *Cryptosporidium*, in drinking water. Infants, some elderly or immuno-compromised such as those undergoing chemotherapy for cancer; those who have undergone organ transplants; those who are undergoing treatment with steroids; and people with HIV/AIDS or other immune system disorders can be particularly at risk from infections. You should seek advice about drinking water from your physician or health care provider. Additional guidelines appropriate means to lessen the risk of infection by *Cryptosporidium* are available from the Safe Drinking Water Hotline at **800-426-4791**.

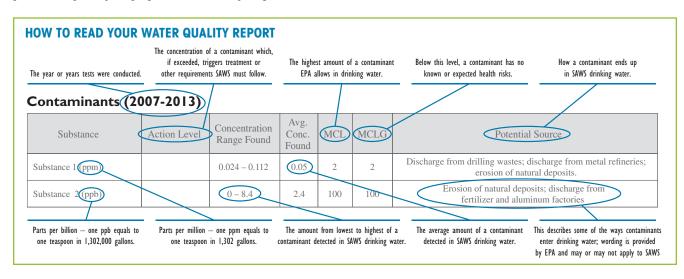



2014 WATER QUALITY REPORT SAN ANTONIO WATER SYSTEM

	IFOI	DAA D	AOT	EDIA
GUI	JITUI	RM B	AUI	EKIA

Constituent	MCLG	Total Coliform MCL	Highest Number of Positive	Fecal Coliform or E. Coli MCL	Total Number of Positive <i>E. Coli</i> or Fecal Coliform Samples	Violation	Likely Source of Contamination
Coliform Bacteria	0	5% of monthly samples are positive	Highest monthly % of positive samples: 1.16%	0	0	No	Naturally present in the environment

MAXIMUM RESIDUAL DISINFECTANT LEVEL

Disinfectant	Test Year	Average Concentration Found	Minimum Level	Maximum Level	MRDL	MRDLG	Units	Likely Source of Contamination
Chlorine Residual, Free	2013	1.13	0.01	2.5	4	4	ppm	Disinfectant used to control microbes

LEAD AND COPPER

Constituent	Date Sampled	MCLG	AL	90th Percentile	Number of Sites Over AL	Units	Violation	Likely Source of Contamination
Copper	2012	1.3	1.3	0.234	0	ppm	No	Corrosion of household plumbing systems; erosion of natural deposits; leaching from wood preservatives
Lead	2012	0	15	3.53	0	ppb	No	Corrosion of household plumbing systems; erosion of natural deposits

DISINFECTANTS AND DISINFECTION BY-PRODUCTS

Constituent	Collection Date	Highest Locational Running Annual Average	Concentration Range Found	MCLG	MCL	Units	Violation	Likely Source of Contamination
Total Trihalomethanes (THMs)	2013	49.15	1.4-85.2	NA	80	ppb	No	By-product of drinking water disinfection
Total Haloacetic Acids (HAAs)	2013	13.75	<6.0-20.9	NA	60	ppb	No	By-product of drinking water disinfection

INORGANIC CONTAMINANTS

Constituent	Collection Date	Highest Level Detected	Concentration Range Found	MCLG	MCL	Units	Violation	Likely Source of Contamination	
Barium	2013	0.0628	0.0307-0.0628	2	2	ppm	No	Discharge from drilling wastes; discharge from metal refineries; erosion of natural deposits	
Fluoride	2013	0.84	0.14-0.84	4	4	ppm	No	Erosion of natural deposits; discharge from fertilizer and aluminum factories; additive which promotes strong teeth	
Nitrate	2013	2.53	0.04-2.53	10	10	ppm	No	Runoff from fertilizer use; leaching from septic tanks; sewage; erosion of natural deposits	
Sodium	2013	17.8	7.87-17.8	NA	NA	ppm	No	Erosion of natural deposits	

RADIOACTIVE CONTAMINANTS

Constituent	Collection Date	Highest Level Detected	Concentration Range Found	MCLG	MCL	Units	Violation	Likely Source of Contamination			
Gross Beta	2013	5.6	<4.0-5.6	0	50	pCi/L	No	Decay of natural and man-made deposits			
Gross Alpha, including Radon and Uranium	2013	2.9	<2.0-2.9	0	15	pCi/L	No	Erosion of natural deposits			

VOLATILE ORGANIC CONTAMINANTS

Constituent	Collection Date	Highest Level Detected	Concentration Range Found	MCLG	MCL	Units	Violation	Likely Source of Contamination
Tetrachloroethylene	2013	0.8	0-0.8	0	5	ppb	No	Discharge from factories and dry cleaners
Xylenes, Total	2013	1	0-1	1,000	1,000	ppb	No	Discharge from petroleum and chemical factories



2014 WATER QUALITY REPORT SAN ANTONIO WATER SYSTEM

INORGANIC CONTAMINANTS, SECONDARY CONSTITUENTS

Collection Date	Units	Highest Level Detected	Concentration Range Found	Secondary Standard
2012	ppm	318	231–318	NA
2012	ppm	67.1	66.8-67.1	NA
2012	ppm	20	16.8-20	250
2012	ppm	226	226-226	NA
2012	ppm	14.2	14.2-14.2	NA
2012	ppm	0.00157	0.00149-0.00157	0.1
2012	Units	7.7	7.7-7.7	6.5-8.5
2012	ppm	10	9.38-10	NA
2012	µmhos/cm	604	484-604	NA
2012	ppm	34	13.6-34	300
2012	ppm	269	269–269	500
2012	ppm	0.0221	0.0029-0.0221	5
	2012 2012 2012 2012 2012 2012 2012 2012	Collection Date Units 2012 ppm 2012 ppm 2012 ppm 2012 ppm 2012 ppm 2012 ppm 2012 Units 2012 ppm 2012 ppm 2012 ppm 2012 ppm 2012 ppm 2012 ppm 2012 ppm	Collection Date Units Highest Level Detected 2012 ppm 318 2012 ppm 67.1 2012 ppm 20 2012 ppm 226 2012 ppm 14.2 2012 ppm 0.00157 2012 Units 7.7 2012 ppm 10 2012 pmhos/cm 604 2012 ppm 34 2012 ppm 269	2012 ppm 318 231-318 2012 ppm 67.1 66.8-67.1 2012 ppm 20 16.8-20 2012 ppm 226 226-226 2012 ppm 14.2 14.2-14.2 2012 ppm 0.00157 0.00149-0.00157 2012 Units 7.7 7.7-7.7 2012 ppm 10 9.38-10 2012 pmhos/cm 604 484-604 2012 ppm 34 13.6-34 2012 ppm 269 269-269

DEFINITIONS

The preceding tables contain scientific terms and measures, some of which may require explanation.

AL (Action Level) – The concentration of a contaminant which, if exceeded, triggers treatment or other requirements which a water system must follow.

ALG (Action Level Goal) – The level of a contaminant in drinking water below which there is no known or expected risk to health. ALGs allow for a margin os safety.

MCL (Maximum Contaminant Level) – The highest level of a contaminant that is allowed in drinking water. MCLs are set as close to the MCLGs as feasible using the best available treatment technology.

MCLG (Maximum Contaminant Level Goal) – The level of a contaminant in drinking water below which there is no known or expected risk to health. MCLGs allow for a margin of safety.

MFL - Million fibers per liter (a measure of asbestos)

MRDL (Maximum Residual Disinfectant Level) – The highest level of a disinfectant allowed in drinking water. There is convincing evidence that addition of a disinfectant is necessary for control of microbial contaminants.

MRDLG (Maximum Residual Disinfectant Level Goal) – The level of a drinking water disinfectant below which there is no known or expected risk to health. MRDLGs do not reflect the benefits of the use of disinfectants to control microbial contaminants.

NA - Not applicable

NTU - Nephelometric Turbidity Units

pCi/L - Picocuries per liter (a measure of radioactivity)

ppm - Parts per million or milligrams per liter (mg/L)

ppb – Parts per billion or micograms per liter (µg/L)

ppt - Parts per trillion or nanograms per liter (ng/L)


ppq – Parts per quadrillion or picograms per liter (pq/L)

II - Treatment technique

µmhos/cm - Micromhos per centimeter (a measure of conductivity)

STATE WATER LOSS AUDIT

In the water loss audit submitted to the Texas Water Development Board for the time period of January through December 2013, our system lost an estimated 11,764,537,022 gallons of water through main breaks, leaks, inaccurate customer metering, theft and other causes. If you have any questions about the water loss audit please visit www.saws.org/wateraudit or call 210-704-7297.

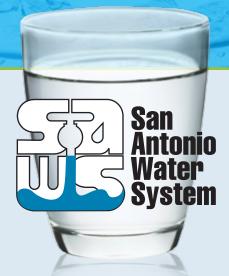

SAN ANTONIO WATER SYSTEM

PWS ID Number: TX 0150018

Questions About Your Water Quality Report?

If you would like more information or a copy of this Water Quality Report, call:

210-233-3546

Call 24 Hours a Day to:

- Report leaks, main breaks, or sewer back-ups
- Discuss water quality concerns

210-704-SAWS (210-704-7297)

In Your Neighborhood

SAWS External Relations team extends its community outreach efforts with neighborhood leaders through homeowners associations and neighborhood meetings, schools and community gatherings. Call us for more information about how we can assist in your neighborhood.

210-233-3246

Website

Our website has the latest news and program information on water issues.

www.saws.org

En español

Este informe incluye información importante sobre el agua potable. Si tiene preguntas o comentarios sobre éste informe en español, favor de llamar al:

210-233-3546

Para hablar con una persona bilingüe en español.

Join the MySAWS conversation





